

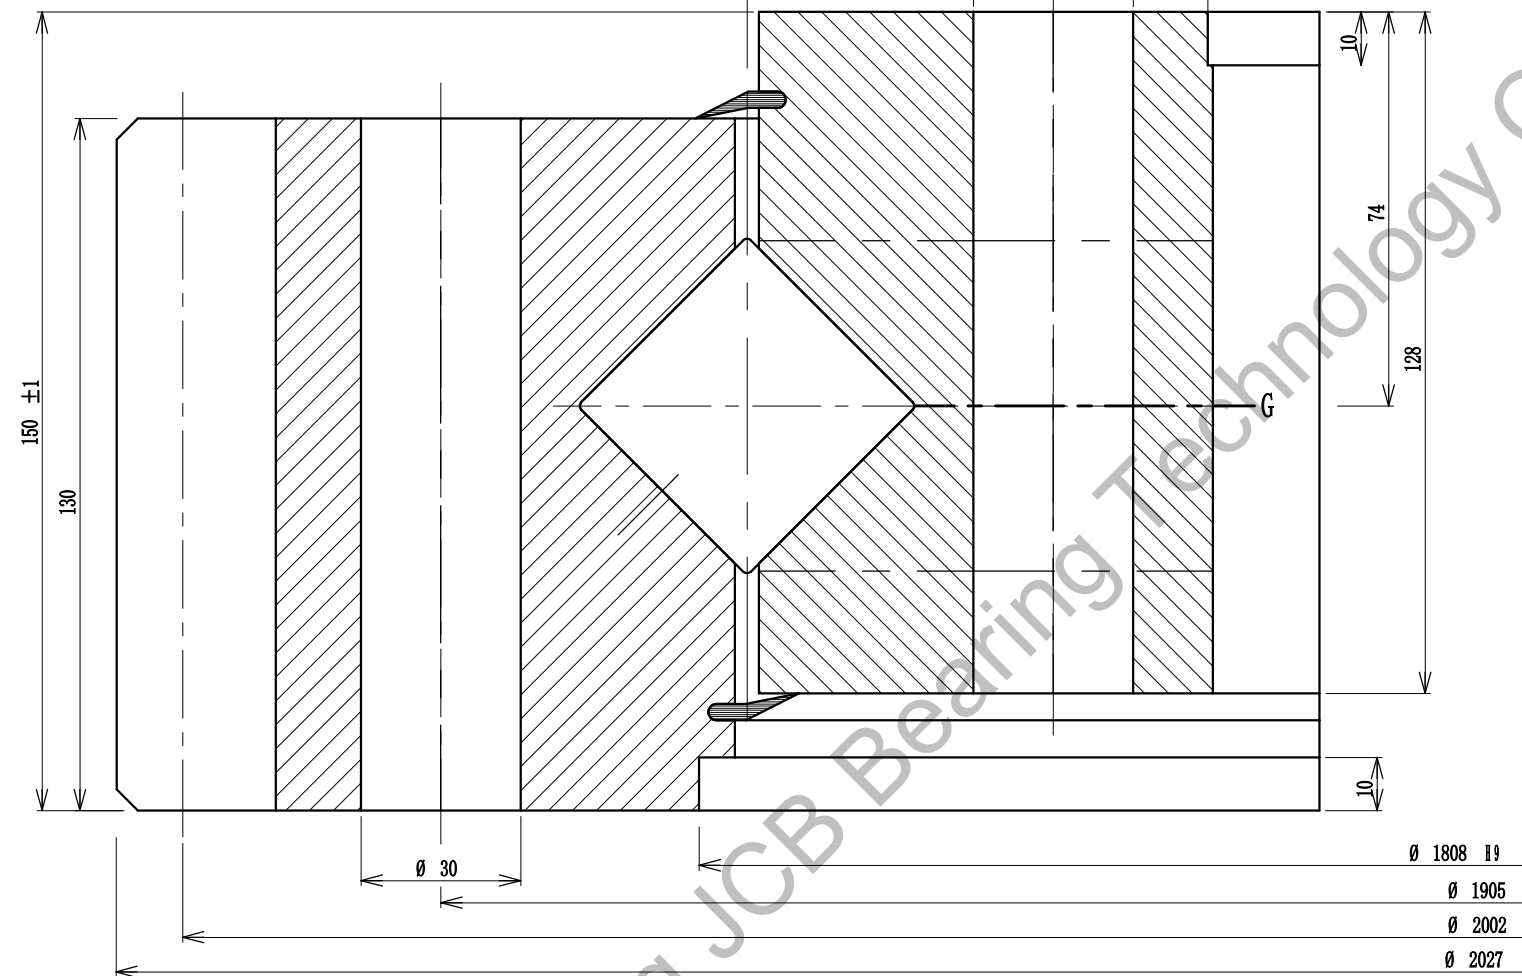



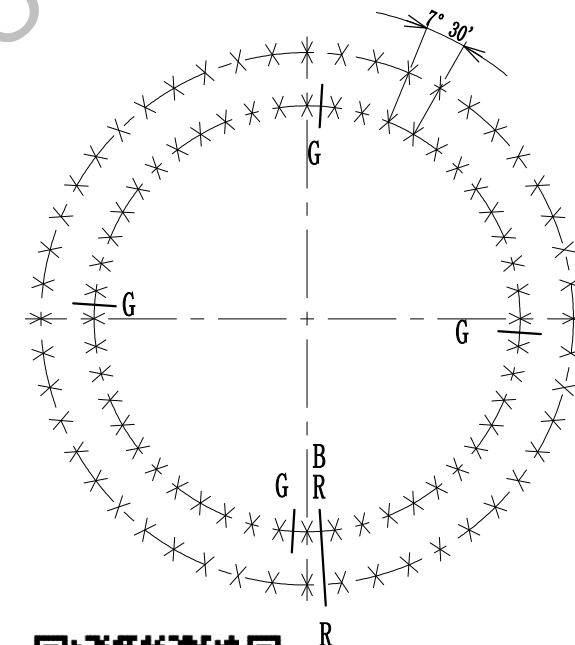

Implantation suivant A
Implantation according to A
Ansicht nach A



Denture - Gear - Verzahnung Droite		Tolérances générales suivant IT-ETR-061 General tolerances according to IT-ETR-061 Allgemeine toleranzen nach IT-ETR-061						Masse estimée 1013 kg Gewicht ca 1013 lbs Estimated weight	N° 06-1790-09		
Module 14	Angle de pression 20°	X	R.E. 48 Trous de fixation Ø 30 equiv. O.R. 48 Mounting holes Ø 30 equiv. A.R. Befestigungsbohrungen gl. Abst.		Des.				Indice A		
Module - Modul 14	Pressure angle Eingriffswinkel 1.50		R.I. 48 Trous de fixation Ø 30 equiv. I.E. 48 Mounting holes Ø 30 equiv. I.R. Befestigungsbohrungen gl. Abst.								
Diametral pitch 142	Troncature - Kopfkürzung		R.E. 4 Trous de graisseurs M 10 x 1.00 equiv. O.R. 4 Grease holes M 10 x 1.00 equiv. A.R. Schmierbohrungen gl. Abst.								
Nbr de dents 142	Troncature - Kopfkürzung		R.I. 4 Trous de graisseurs M 10 x 1.00 equiv. I.E. 4 Grease holes M 10 x 1.00 equiv. I.R. Schmierbohrungen gl. Abst.								
Diamètre primitif 1988				Date.	Ver.	Date.	Ech.				
Pitch diameter - Teilkreissdurchmesser 1988											
Report 2 m d 14											
Add. mod. 2 m d 14											
Cote sur 17 dents 713.810		G							Luoyang JCB Bearing Technology Co., Ltd Add: No.3 Lianmeng road, Luoyang, Henan, China Postal: 471003 Phone: +86-379-68611678 Fax: +86-379-68611679 E-mail: sales@jcb-bearing.com		
Measurement on teeth 713.390											
Zahnessweite bei Zähnen 713.390											
Faux rond au diamètre primitif - Run out on P.D. Rundlauffehler am Teilkreis											
Non trempée 0.64		B R	Position approximative du bouchon et du raccord de trempée Filler plug and hardening connection of raceway ca Stopfen - und heerteschlupf - position								
Ungehartet 0.64											
Trempée 0.84											
Gehartet 0.84											